



(V1.00)

.....

.....

.....

.....

Resolver

"

1

$$U_{R_1R_3}(t) = U_{1m} (\sin\omega t) \quad 1$$

$$U_{1m} \quad \omega$$

2

$$U_{S_1S_3}(t) = U_{2m} (\sin\omega t + \alpha) \cos(\theta) \quad 2$$

$$U_{S_2S_4}(t) = U_{2m} (\sin\omega t + \alpha) \sin(\theta) \quad 3$$

$$\alpha \quad U_{S_1S_3} \quad U_{S_2S_4} \quad U_{2m} \quad \omega \quad \theta$$

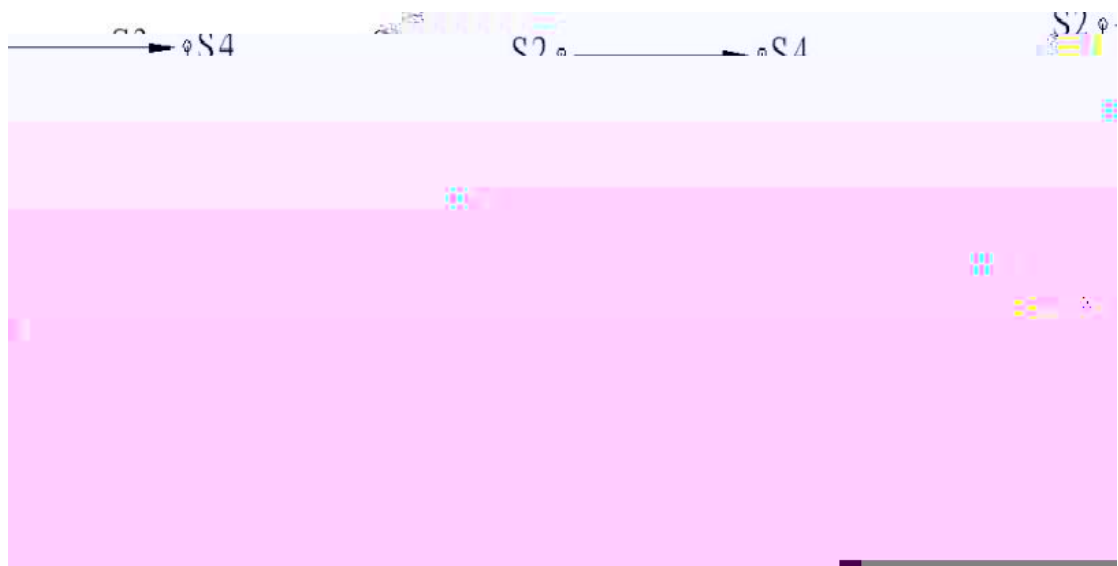


图 3、旋转变压器原理图

1

10V 400Hz 2kHz 10kHz

2

3

4

5

3 ° 12 °

6

0 ° 90 ° 180 ° 270 ° 1

7

0 °

8

1

0.02% 0.1%

2

2 '

10 '

3

±

60 °

4

5

2

表 2、旋转变压器的精度等级与对应误差值

	0	I	II	III
%	0.05	0.1	0.2	0.3
'	3	6	12	18
'	2	4	8	18
'	5	10	20	30

“ ” “ ”

1

2

3

4

5

6

7

1

- a)
- b)
- c)
- d)

2

- a)
- b)
- c)

3

- a)
- b)

4

- a)
- b)

RXMC-V100

Mbps

RS422/RS485

8163264

128

0.1Ω

18AWG0.75mm²

Φ7.512mm

DB15

4Ω

表 1、DB15 孔座连接器管脚定义

1	CJ-COS-		8	JJ-SIN-	
2	CJ-SIN-		9	CJ-COS+	
4	EXC+		10	CJ-SIN+	
5	EXC-		14	JJ-COS+	
7	JJ-COS-		15	JJ-SIN+	

			5VDC ± 5%
		2m	18AWG 0.75mm ²
RS422	DB9		

表 2、DB9 孔座连接器管脚定义

1	TX+	RS422	
2	TX-	RS422	
3	RX-	RS422	
4	RX+	RS422	
5 6 7	GND		
8 9	5V	5V	

	105mm × 86mm × 23mm		
	5VDC ± 5%		
		± 200mA	
	≤ 2W		
		5V	
	9000rpm	3	

表 3、双通道旋变最大可跟踪机械角速度与精机磁极对数的关系

	rpm	
8	1125	
16	562.5	
32	281.25	
64	140.625	
128	70.3125	

	1kHz	
-40	+85	
		4

表 4、双通道旋转变压器精机磁极对数与分辨率的关系

	bit	1LSB"
8	19	2.47
16	20	1.24
32	21	0.62
64	22	0.31
128	23	0.16

RS422 RS485

3.75Mbps

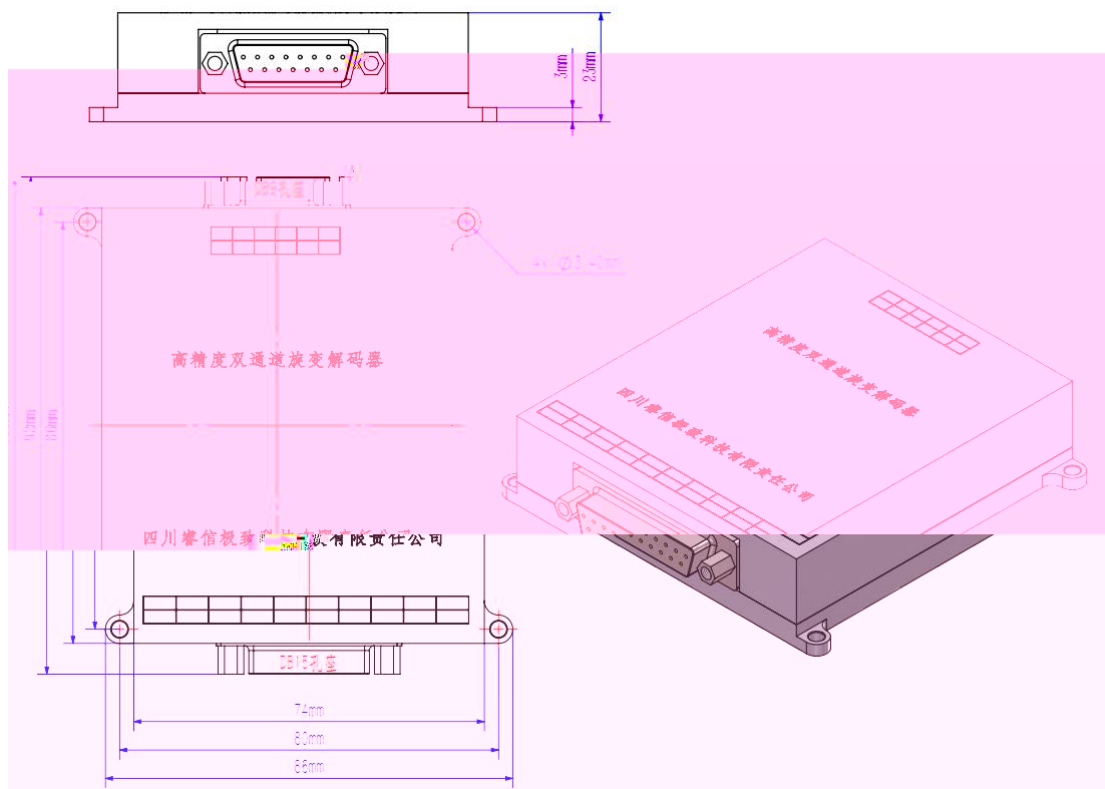


图 1、双通道旋变解码器机械安装参数